

A.R.M. (USA), Inc. 1506 Fernwood Rd. Wintersville, OH 43953 740.264.6599 740.266.2953 Fax Bulletin No: SAHF20190418 Release Date: April 18, 2019 Effective Date: April 18, 2019

Supercedes:

Completion Date: Immediate

Page: 1 of 1

SAFETY ALERT

Manufacturer: A.R.M. (USA), Inc. Model(s): All Ride Name: Highflyer Affected Production Dates: All

AFFECTED SERIAL NUMBERS

HF02/06/01/94USA

HF03/18/04/94USA

HF04/06/06/94USA HF05/17/06/94USA HF06/08/07/94USA

HF07/06/10/95USA HF08/15/02/96USA

HF09/19/07/98USA HF101-02-15-07R

HT102

HT103

ABSTRACT OF ISSUE

Prior to continued operation, all M39 x 150 mm grade 8.8 plain finish passenger carriage attachment bolts with manufacturer marking "OITV" and mating full nuts to be replaced.

REASON FOR RELEASE

Fracture found in new uninstalled bolt from manufacturer bearing marking "OITV".

ACTION TO BE TAKEN

Immediately cease operation of ride.

Inspect M39 X 150mm passenger carriage attachment bolts to identify manufacturer markings. All bolts with the manufacturer marking "OITV" and associated nuts must be removed from service, discarded and replaced prior to continued operation.

Grade Marking Mandacturer Identification Marking OffV

Please note, as per ride manual, bolts are to be replaced annually.

DETAIL OF ISSUE

Document compliance in the ride's maintenance log and retain proof of purchase for replacement bolts.

CERTIFICATION OF COMPLIANCE

I certify that all M39 carriage attachment bolts with the manufacturer marking "OITV" and mating nuts have been replaced with new.

Ride Owner	Ride Serial Number	
Printed Name	Signature	Date

Submit this executed form along with all supporting documentation prior to returning the ride to service.

Submittal Options

MAIL:

Safety Compliance A.R.M. (USA), Inc. 1506 Fernwood Rd Wintersville, OH 43953

EMAIL

armbulletin@armrides.com

FAX:

740-266-2953

CUSTOMER SUPPORT:

740-264-6599

NOTICE