Issuing Entity: Battech Enterprises, LLC

P. O. Box 13114 Salem, Oregon 97309 Phone: 503-362-2341 Fax: 503-362-2536

www.battechrides.com

Bulletin # SR-5K-1705-01A
Release Date: May 1, 2017
Effective Date: May 1, 2017
Supercedes: N/A
Completion Date: July 1, 2017

Page 1 of 3

## SAFETY BULLETIN

Ride Manufacturer: Battech Enterprises, LLC
Ride Name: Cliff Hanger
Model #: All

Affected Production Dates: November 2009 – May 2017
Affected Serial #'s: All

<u>Abstract of Issue:</u> Battech Enterprises, LLC has been made aware of a potentially harmful situation with the mount plate for the latch on the restraint of the passenger carrier assembly on the Cliff Hanger amusement ride.

Reason for release: To ensure that all Cliff Hanger rides install a protective guard on the restraint latch mount plate to prevent potential injuries in this area. Installation procedures are included.

## Action to be taken:

- 1. No Cliff Hanger is to be operated after July 1, 2017 until this Safety Bulletin is complied with.
- 2. Contact Battech at (503) 362-2341 to arrange purchase of the restraint latch covers.
- 3. Install the covers as explained on Page 2 and illustrated on Page 3.

Bulletin: SR-5K-1705-01A Release Date: May 1, 2017

Page 2 of 3

## **Detail of issue:**

## Prepare Cliff Hanger for Installation of the Restraint Latch Mount Cover

- 1. The ride must be set-up to perform this operation with the restraints latched into the passenger carrier assemblies and the **SPRING REEL ASSEMBLIES DISCONNECTED**.
- 2. Per the attached illustration, using a ¾" wrench, remove the top two nuts that hold the threaded 'U-Bend' latch to the latch mount assembly. DO NOT ADJUST THE NUTS ON THE BOTTOM SIDE.
- 3. Without removing the 'U-Bend' from the latch mechanism of the passenger carrier assembly, install the latch mount cover over the threaded portion per the attached illustration.
- 4. Re-install the two nuts onto the threaded portion of the 'U-Bend' assembly.
- 5. Verify proper adjustment of the latch mechanism by releasing and latching a few times. Adjust as necessary.

Bulletin: SR-5K-1705-01 Release Date: May 1, 2017 Page 3 of 3

