



[Home](#) » [Venture Cobra rusted structure](#)

Venture Cobra rusted structure

Posted 22-Sep-2008 - Last updated 4-Feb-2011

Manufacturer: [Hi-Lite - Watkins - Venture](#)

Posted By: [Florida Department of Agriculture](#)

See attached pictures taken by one of our inspectors in Florida where they found rusted out structure components at both upper satellites on a "Cobra" ride manufactured by Venture Rides while inspecting at the Holmes County Fair in Florida. I contacted Mike Howard with High Lite corporation (bought out parts rights to Venture) who stated that he had another "Cobra" ride in their shop being repaired for the same problem.

- [DSCF0268.jpg](#)
- [DSCF0269.jpg](#)
- [DSCF0270.jpg](#)
- [DSCF0271.jpg](#)
- [DSCF0272.jpg](#)
- [image001.jpg](#)
- [image002.jpg](#)
- [image003.jpg](#)

Rides and Devices:

[Cobra](#)

CARES Disclaimer

This information on this website has been gathered by CARES member agencies as a public service. It is not intended to be, and does not constitute, a comprehensive list. CARES believed the information to be correct and current when it was posted, but there are regular changes in this information that may not be reflected on this site. All requirements and recommendations should be verified with the manufacturer and/or the jurisdictional authority to ensure safe and proper use. If you identify any errors, please [contact CARES](#).





