

WISDOM INDUSTRIES, INC



FERRIS WHEEL BULLETIN

DATE:

MARCH 1995

RIDE:

FERRIS WHEEL

SUBJECT:

JOURNAL BOLT INSPECTION AND REPLACEMENT

There have been reports of Ferris Wheel journal bolts cracking at the reduced diameter where the seat hangs.

As a result of this Wisdom Industries requires replacement of the Ferris Wheel journal bolts every five years. Additionally, a magnaflux inspection is required every two years of this area of journal bolts.

The journal bolts are a standard journal bolt manufactured by Eli Bridge Company and is not modified by Wisdom Industries.

Reinstall the journal bolt using a 7/8" NC heavy thin locknut.

When tearing down the ride, loosen the nut 1/2 turn before folding the sweeps.

Tighten after set up.