


Zamperla Inc.

Maintenance Bulletin

January 1991

RE: Mini-Enterprise Tension Rod Attachment

A customer has reported the development of fractures in the structure that attaches the tension rod to the frame on the Mini-Enterprise ride. The cracks developed in the welds, and spread into the parent metal in one area. This ride is approaching 10 years of service. We are advising all Mini-Enterprise owners to visually inspect this area of their ride. Any indications of cracking should be reported to our technical service department and subjected to magnetic particle testing to determine the extent of the damage.

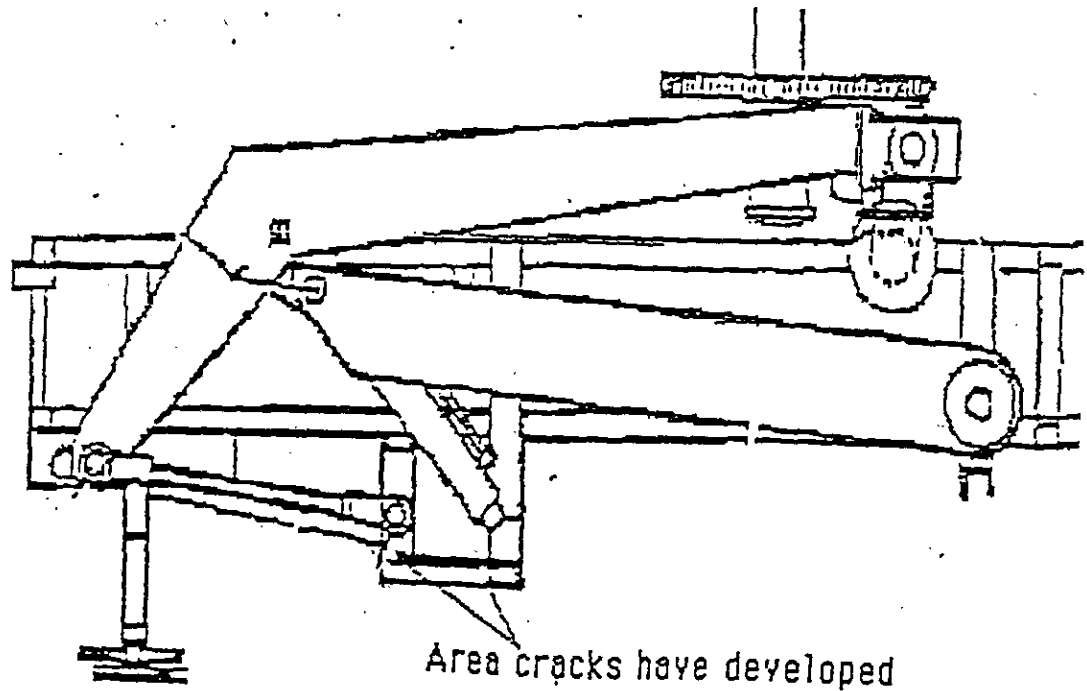

Rene Bernier
Technical Service Manager