



A.R.M. (USA), Inc.
 1506 Fernwood Rd.
 Wintersville, OH 43953
 740.264.6599
 740.266.2953 Fax

Bulletin No: SAHT20190418
Release Date: April 18, 2019
Effective Date: April 18, 2019
Supercedes:
Completion Date: Immediate
Page: 1 of 1

SAFETY ALERT

Manufacturer: A.R.M. (USA), Inc.
 Ride Name: Screamer

Model(s): All
 Affected Production Dates: All

AFFECTED SERIAL NUMBERS

HT101/03/15/99USA
 HT102-10-20-01
 HT103

ABSTRACT OF ISSUE

Prior to continued operation, all M39 x 150 mm grade 8.8 plain finish passenger carriage attachment bolts with manufacturer marking "OITV" and mating full nuts to be replaced.

REASON FOR RELEASE


Fracture found in new uninstalled bolt from manufacturer bearing marking "OITV".

ACTION TO BE TAKEN

Immediately cease operation of ride.

Inspect M39 X 150mm passenger carriage attachment bolts to identify manufacturer markings. All bolts with the manufacturer marking "OITV" and associated nuts must be removed from service, discarded and replaced prior to continued operation.

Please note, as per ride manual, bolts are to be replaced annually.

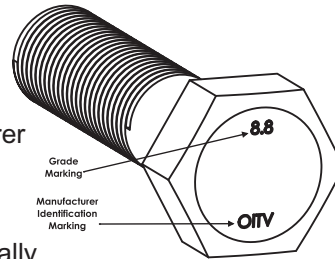

DETAIL OF ISSUE

Document compliance in the ride's maintenance log and retain proof of purchase for replacement bolts.

CERTIFICATION OF COMPLIANCE

I certify that all M39 carriage attachment bolts with the manufacturer marking "OITV" and mating nuts have been replaced with new.

Ride Owner

Ride Serial Number

Printed Name

Signature

Date

Submit this executed form along with all supporting documentation prior to returning the ride to service.

Submittal Options

MAIL:
 Safety Compliance
 A.R.M. (USA), Inc.
 1506 Fernwood Rd
 Wintersville, OH 43953

EMAIL:
 armbulletin@armrides.com

FAX:
 740-266-2953

CUSTOMER SUPPORT:
 740-264-6599

NOTICE

ONLY COMPONENTS SPECIFIED, AUTHORIZED, OR PROVIDED BY A.R.M. (USA), INC. SHALL BE USED. A.R.M. (USA), INC. SPECIFICALLY DISCLAIMS ANY LIABILITY ASSOCIATED WITH THE USE OF UNAUTHORIZED COMPONENTS OR MODIFICATIONS AND/OR ALTERATIONS OF AUTHORIZED COMPONENTS.